



FOR THE LOVE OF SEWING


Technical Service Tip !

Baby Lock Unity, Crescendo, Spirit, Needle Threader Exchange Procedure:

The new advanced needle threader hook that has been added to the BLTY, BLCR, and BLPY has a spring return spring similar to the BLSO. Failure to detach spring prior to removing the threader hook will cause damage to the spring.

There has also been a 'C' clip (part number 048025346) added under the threader hook to secure it in place.

You must remove the 'c' clip before attempting to remove the threading unit.

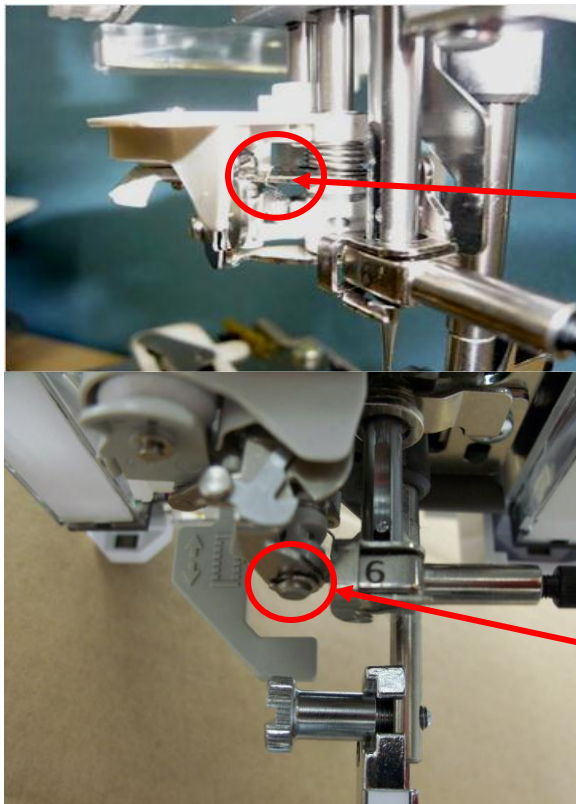

1. First detach spring from metal plate, with use of a small tool such as a crochet hook.

Remove c-clip from below threader